

## MACHINE SERVICE REPORT

RO Number: E34273 | Service Date: April 15, 2026 11:23 am

### Machine Details

<b>Customer:</b>	Aussie Hammer	<b>Hour Meter:</b>	1681
<b>Model:</b>	135-7	<b>Service Type:</b>	500
<b>Serial Number:</b>	Yy09053184	<b>Service Interval:</b>	500 Hour Service

Before Service Photos



**KOBELCO**

Model : SK135SR-7

Serial Number : YY09053184

YN20102489P1



**! DANGER**

**CRUSH  
ZONE**

Keep Clear





## Parts Replaced/Service

Part Type	Status
Engine Oil Filters	Done
Hydraulic Return	Done
Primary Fuel	Done
Fuel /Water	Done
Outer Air	Done
Inner Air	Done
A/C Filter x1	Done
Oil Sample Kits	Done
Grease	Done
Brake Cleaner	Done

## Fluid Levels & Replacements

Engine Oil <b>17 LTS</b>	Final Drive Oil <b>6 LTS</b>	Hydraulic Oil <b>20 LTS</b>	Grease <b>1 LTS</b>
-----------------------------	---------------------------------	--------------------------------	------------------------

## System Measurements

Charge Rate <b>28 V</b>
----------------------------

## Service Checklist Completed

### 500 Hour Service:

- Replace Engine Oil Fluid
- Replace Engine Oil Filter
- Replace Hydraulic Filter
- Replace Primary Fuel Filters
- Check Hydraulic Oil Level
- Check Slew Reduction Oil Level
- Check Final Drive Oil Level
- Check Coolant Radiator Level
- Check Engine Fan Belts Tension
- Check A/C Belt Tension
- Check / Adjust Track Tension
- Check Upper / Lower Rollers
- Check Machine Horn Operation
- Check Radiator Hoses, No Leaks
- Check 2 Speed Travel Operation
- Check Neutral Start Working
- Check Safety Lever Operation
- Check No Fault Codes Active
- Check E-Stop Operation
- Drain Water from Fuel Tank
- Check No Visual Oil Leaks
- Clean Outer Air Filter
- Clean Cabin Air Filters
- Check Flashing Light Operation
- Check Work Light Operation
- Visual Inspection Over Machine
- Check Wiper Bottle Water Level
- Check Quick Hitch Operation
- Check Quick Hitch Pins / Bolts
- Check Radiator Cap Condition
- Grease Machine - All Pins / Slew
- Replace Fuel Water Filters
- Replace Primary Fuel Filter
- Replace Engine Outer Air Filter
- Clean Radiator Core Filters
- Replace Final Drive Reduction Oils

### Service Completion:

- Reset Machine Dash Hours
- Fit Next Service Sticker to Window

### Comments:

Machines hydraulic tank breather stud broken making the tank unable to release pressure which caused a mess, requires a new hydraulic tank breather. Secondary fuel water filter bottom drain plug is snapped in the housing, requires a new bottom drain plug. Hour meter has been inoperative is not counting the hours. I have included 2 photos of the incorrect and correct hours from the back screen. Tilt hitch hose fittings were loose causing a hydraulic leak, tightened up to rectify issue

**Next Service Due:**

2180

After Service Photos
















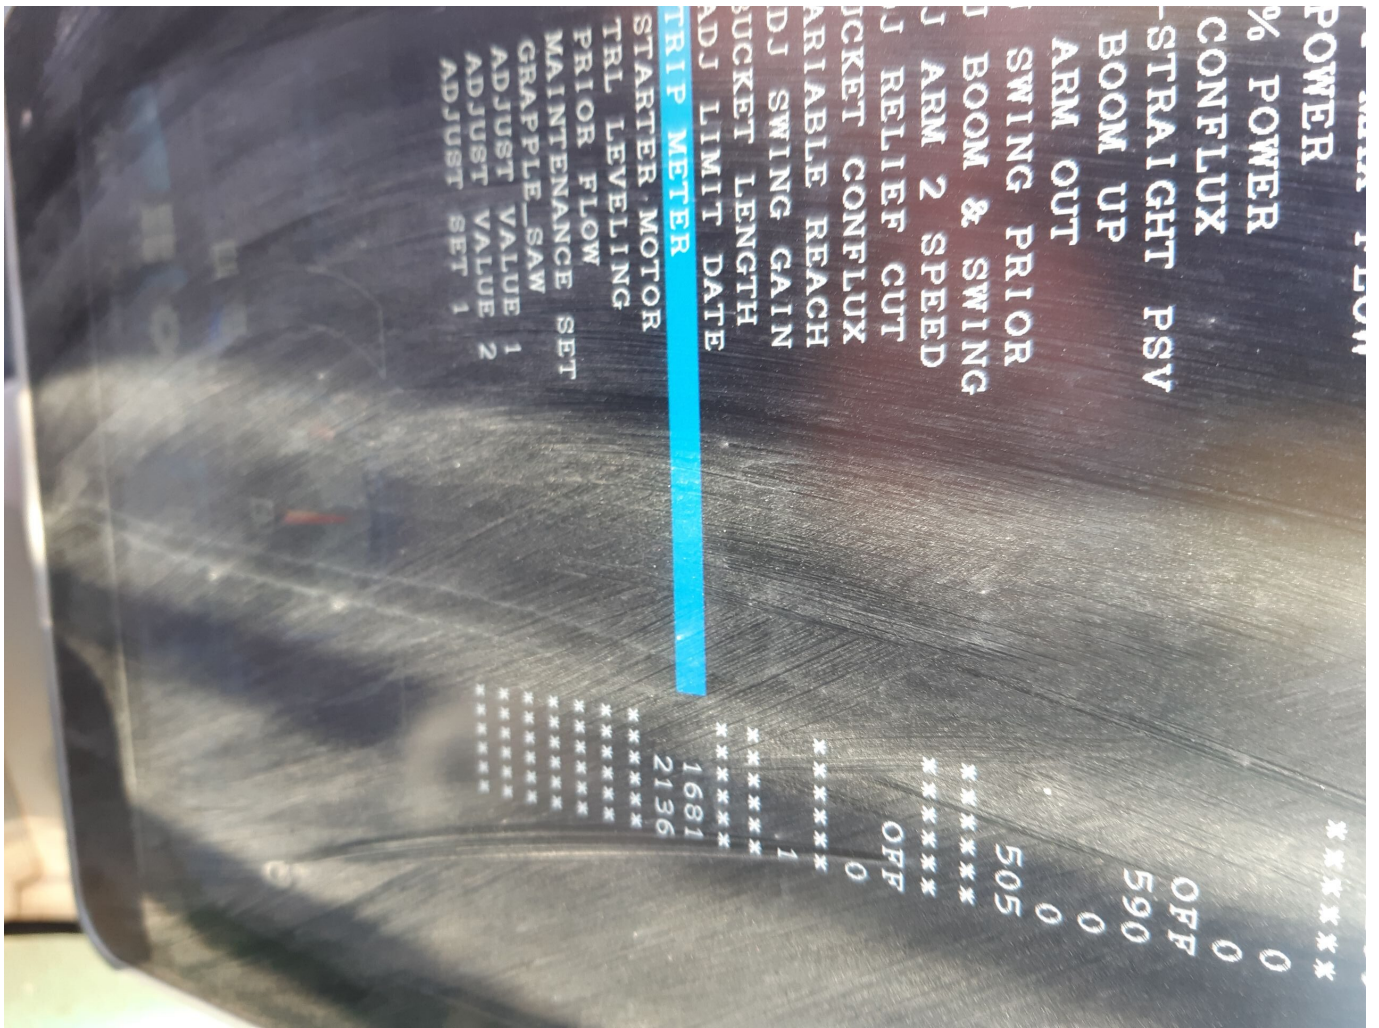

## Service Completion

Service Date: April 15, 2026 11:23 am  
 Technician: 728

Report Generated: April 15, 2026 11:23 am  
 RO Number: E34273